



Dart Aerospace Ltd.
1270 Aberdeen St
Hawkesbury, ON
K6A 1K7
Canada

Tel (613) 632-5200
Fax 613 632-5246

D206-642-241
Job Sheet 187341



Part No: D206-642-241

Job Qty: 1 ea

Part Name: Replacement Skidtube, High Gear with Standard Wearplates Fits LH or RH



Part Weight: 0 lbs

Status: New

Priority: Medium

Job Created: 12/3/18

Job Tracking No:

Due Date: 12/18/18

Created By: Jesse White

Type: SOLD

Description:

Note: DWG REV F(DEO) IPP Rev: 04.12.02 Revised procedural steps KJ/JLM IPP RevP: revise and update route/bom DD 10.01.06 ver:EC IPP rev Q 10.02.19 per PAR 09-043 EC verified by: DD IPP Rev:R 12.11.22 now swage per ecn12-679 DD ver:JLM IPP Rev:S 14.04.24 ECN14-520 DD ver:JLM

Ship Via:



1270 Aberdeen Street
Hawkesbury, ON K6A 1K7
CANADA
TEL : 1 613 632-5200
Email: sales@dartaero.com
www.dartaerospace.com

Container No. S137415



Part: D206-642-241

Job No: 187341

Serial No/Batch: S137415

Revision:

Inspector:

Exp Date:

Instructions: TC STC SH98-4 Issue 2, FAA STC SA00475SE 15/10/28, EASA STC

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Job Routing									
Op No	Operation	Qty	Start Date	Due Date	Standard		Workcenter/Supplier		Sign-off
					Setup Hrs	Run Hrs	Workcenter / Supplier	Lead Time	
90	Start up Operation	1 Ea		12/18/18	0.00	0.00	Start Up Skid tubes-1		DD
110	Skid tubes	1 pcs		12/18/18	0.00	2.22	Skid tubes-2		DD, BE
120	QC	1 pcs		12/18/18	0.00	0.00	QC5		PD 19-01-02
130	QC	1 pcs		12/18/18	0.00	0.00	QC9		PD 19-01-02
140	HandFinish	1 pcs		12/18/18	0.00	0.33	HandFinish1		EL 19-02-06
150	QC	1 pcs		12/18/18	0.00	0.00	QC7-1		M.G.
160	Skid tubes	1 pcs		12/18/18	0.00	2.50	Skid tubes-2		14
180	Skid tubes	1 pcs		12/18/18	0.00	2.50	Skid tubes-2		14
190	QC	1 pcs		12/18/18	0.00	0.00	QC5		BE
200	Skid tubes	1 pcs		12/18/18	0.00	2.50	Skid tubes-2		BE 308 DT
220	QC	1 pcs		12/18/18	0.00	0.00	QC9		PD 19-02-19
230	QC	1 pcs		12/18/18	0.00	0.00	QC5		PD 19-02-19
240	HandFinish	1 pcs		12/18/18	0.00	0.33	HandFinish2		DR 19/2/21
250	Powdercoat	1 pcs		12/18/18	0.00	0.28	Powdercoat1		BE 19-2-05
260	QC	1 pcs		12/18/18	0.00	0.00	QC3		14 19-2-25
270	HandFinish	1 pcs		12/18/18	0.00	1.06	HandFinish3		14 19-2-25
300	QC	1 pcs		12/18/18	0.00	0.00	QC5		DAS FEB 26 2019
305	DC	1 pcs		12/18/18	0.00	0.00	DC		21 FEB 26 2019
310	Packaging	1 pcs		12/18/18	0.00	0.00	Packaging3-1		21 FEB 26 2019
320	QC21-FG	1 Ea		12/18/18	0.00	0.00	QC21		21 FEB 26 2019

Part Op 110 - 1-Deburr Fwd edge of tube 2- Remove ridge on inside of Fwd edge of tube as per Dwg D2650 3-Weld Fwd Cap as per Dwg D2650. Use aluminum rod. Grind D2647 to fit as required. 5-Cut Aft end as per dwg D2650 from front of tube and Deburr 6-Remove inner indexing ridge on Aft end of skid tube as per Dwg D2650 7-Open holes for Aft end cap as per Dwg D2650 with #30 Drill Bit using DT8025. 8-Drill pilot holes using Dt 8167. 12-Remove 3/16" cleco's only and open GHW holes to Ø0.500" as per Dwg D2650 14-Remove indexing edge using DT9779 as per Dwg D2650. Leave 0.070" wall minimum. 15-C'sink GHW rivet holes as per Dwg D2650 16-Open crossbolt holes to Ø0.3125" 17-Drill pilot holes using DT8028-3, then open to Ø0.297" as per Dwg D2650. Open Aft cap hole #6. 18- Ream crossbolt spacer holes to finished size as per Dwg D2650, D2650-3 Drilling Detail ***DO NOT OPEN X-BOLT SPACER HOLE OF DETAIL B*** 19-Deburr tube as per QSI 018 and blow out chips from inside the tube

160 - 1- Open and c'sink one crossbolt spacer holes as per Dwg D2650 (DEO Detail B)(without cutting fluid) 2-Deburr and blow out all chips from inside the tube

180 - 1-Locate, install and rivet doublers as per Dwg D2650. Micro-shave rivets as required 2-Bond D2654-3 web in place as per QSI 015. Ensure holes line up.Allow 12 Hrs. cure time before cutting

200 - 1-Remove alodine in one area per DEO detail B from around hole and prepare for welding 2-Prep per QSI 005 and Insert one D2649 crossbolt spacer. Weld as per QSI 004 and Dwg D2650. Remember to back drill each hole to 0.25" before welding the other side. Use aluminum rod. 3-Grind welds flush as per Dwg D2650. 4-Using DT8733, insert (2) D3286-3 spacers as per QSI 004 and Dwg D2650. Remember to back drill each hole to Ø0.402" before welding other side. Use SS rod as required. 5- Insert D4720-1 Spacer. Swage to 0.313" X 0.75" DP per QSI 002. Trim and grind flush per QSI 002 6- Install D2680-041 Nut Plate as per Dwg D2650

240 - Brush alodine tube on crossbolt spacer area, do not acid etch, do not dip tube in tank.

250 - Make sure Nut Plate Thread is protected using paint screw, and mask GHW studs. START TIME: 10:00
FINISH TIME: 10:50 O.V.T. 300 M138997

270 - 1- Install inserts & wearpads as per dwg D2922. Use a drop of Sikaflex inside insert holes before installing wearpad/wearplate.

305 - Photocopy bluefile & type labels per PPP D206-642-241 CHG007

310 - Identify and pack for shipping as per PPP D206-642-241

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042) _____	
Description Work Order Deviation		Disposition		Completed By	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread ☐		FAULT CATEGORY Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread ☐			
Other/Details: _____					

Job BOM					COB300
Part / Item	Component Name	Quantity	Operation	Container	
D2620	Skidtube, 206 Skidtube	1 Ea (1 ea)	90-Start up Operation	3108902	
D2647	Cap	1 Ea (1 ea)	90-Start up Operation	5038805	
D3286-1	Doubler	2 Ea (2 ea)	90-Start up Operation	50419486	
CCR264SS3-3	Cherry Rivet	2 Ea (2 ea)	180-Skidtubes	FM137627	
CR3212-4-03	Cherry Rivet	2 Ea (2 ea)	180-Skidtubes	FM137886-1	
CR3212-4-04	Cherry Rivet	52 Ea (52 ea)	180-Skidtubes	5045671	
D2654-3	Web	1 Ea (1 ea)	180-Skidtubes	5060120	
D2649	Cross Bolt Spacer	1 Ea (1 ea)	200-Skidtubes	5050570	
D3286-3	Spacer	2 pcs (2 ea)	200-Skidtubes	F91160x1	
D4720-1	Spacer	17 Ea (17 ea)	200-Skidtubes	F109097x1	
ALS4-1032-130	Rivnut	44 Ea (44 ea)	270-HandFinish	5030687	
D2646	Aft Cap	1 Ea (1 ea)	270-HandFinish	5007779	
D2651-1	Plug	18 Ea (18 ea)	270-HandFinish	F165010	
D2651-3	O-Ring	18 Ea (18 ea)	270-HandFinish	5044163	
D2680-041	Nut Plate	1 pcs (1 ea)	270-HandFinish	5027462	
D3537-1	Wearpad	4 Ea (4 ea)	270-HandFinish	F158429	
D3537-3	Wearpad	1 Ea (1 ea)	270-HandFinish	5112157	
D4956-13	Wearplate Fwd	1 Ea (1 ea)	270-HandFinish	5040552	
D4956-21	Wearplate Center	1 Ea (1 ea)	270-HandFinish	5081901	
D4956-33	Wearplate Aft	1 Ea (1 ea)	270-HandFinish	5050577	
MS27039-1-08	Screw 5043210 (x34)	46 Ea (46 ea)	270-HandFinish	5050576	
MS27039-4-06	Screw	1 Ea (1 ea)	270-HandFinish	5104013	
NAS1149D0332J	Washer	46 Ea (46 ea)	270-HandFinish	FM11637951	
NAS1149D0463J	Washer	1 Ea (1 ea)	270-HandFinish	5123446	
				5150216	

Job Allocations

Operation	Component Part	Required	Inventory	Allocated
90-Start up Operation	D2620	1	10	0
	D2647	1	22	0
	D3286-1	2	36	0
180-Skidtubes	CCR264SS3-3	2	306	0
	CR3212-4-03	2	182	0
	CR3212-4-04	52	623	0
200-Skidtubes	D2654-3	1	8	0
	D2649	1	104	0
	D3286-3	2	10	0
270-HandFinish	D4720-1	17	121	0
	ALS4-1032-130	44	11,083	0
	D2646	1	48	0
	D2651-1	18	232	0
	D2651-3	18	609	0
	D2680-041	1	37	0
	D3537-1	4	204	0
	D3537-3	1	42	0
	D4956-13	1	12	0
	D4956-21	1	10	0
	D4956-33	1	12	0
	MS27039-1-08	46	672	0
	MS27039-4-06	1	31	0
	NAS1149D0332J	46	1,786	0
	NAS1149D0463J	1	4,173	0

Part Specifications

Specifications could not be found.

Plex 12/3/18 8:55 AM dart.white.jesse

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

QTY -1	QTY -3	QTY -5	QTY -7	PART NUMBER	DESCRIPTION
X				D2650-1	SKIDTUBE ASSEMBLY
	X			D2650-3	SKIDTUBE ASSEMBLY
		X		D2650-5	SKIDTUBE ASSEMBLY
			X	D2650-7	SKIDTUBE ASSEMBLY
1	1	1	1	D2600-1-160	EXTRUSION
1				D2654-1	WEB
	1			D2654-3	WEB
		1		D2654-5	WEB
			1	D2654-7	WEB
1	1	1	1	D2646	AFT CAP
1	1	1	1	D2647	CAP
17	18	19	23	D2649	CROSS BOLT SPACER
16	18	14	22	D2651-1	PLUG
16	18	14	22	D2651-3	O-RING
1	1	1	1	D2680-041	NUT PLATE
2	2			D3286-1	DOUBLER
2	2			D3286-3	STUD
42	44	54	60	ALS7-1032-130	INSERT (or AKS4-1032-130, ALS4-1032-130, ALS7-1032-130)
2	2	2	2	AN960JD10L	WASHER
2	2	2	2	CCR264SS3-3	RIVET
2	2	2	2	CR3212-4-03	RIVET
2	2	2	2	MS27039-1-08	SCREW
1	1	1	1	MS27039-4-06	SCREW
1	1	1	1	AN960JD416	WASHER
52	52			CR3212-4-04	RIVET

F

F

NOTES:

- 1) MATERIAL: N/A
- 2) FINISH: -CHEMICAL CONVERSION COAT PER DART QSI 005 4.1
-POWDER COAT WHITE (4.3.5.1) PER DART QSI 005 4.3
-BLACK ANTI-SKID PAINT AS INDICATED TO 0.5 ABOVE LOCATION RIDGE PER DART QSI 005 4.4
- 3) TOLERANCES: PER DART QSI 018 UNLESS OTHERWISE NOTED
- 4) UNITS: INCHES UNLESS OTHERWISE NOTED
- 5) BREAK SHARP EDGES: 0.005 TO 0.010 MAX
- 6) IDENTIFICATION: NONE
- 7) WEIGHT: N/A
- 8) WELD PER DART QSI 004
- 9) DAMAGE TOLERANCE ON FWD BEND:
THERE SHOULD BE NO VISIBLE WRINKLES IN THE BEND FROM THE GROUND TO A HEIGHT OF 5 INCHES ABOVE THE GROUND. IT IS ACCEPTABLE TO POLISH OUT GOUGES UP TO 0.020 DEEP IN THE BENT PORTION OF THE TUBE. A MAXIMUM REDUCTION IN DIAMETER OF 0.150" IS ACCEPTABLE IN THE BENT PORTION OF THE TUBE.
- 10) BOND WEB INTO OUTER TUBE WITH SIKAFLEX-241/-291 ADHESIVE PER DART QSI 015
- 11) INSERT D2651-1 PLUG C/W D2651-3 O-RING IN HOLES MARKED 'P' (BOTH SIDES OF TUBE)
- 12) DRILL Ø0.297 FOR ALS7-1032-130 INSERTS USING TEMPLATE DT8056-1 ON -1 TUBE, DT8056-3 ON -3 TUBE, DT8056-5 ON -5 TUBE, AND DT8056-7 ON -7 TUBE. INSTALL INSERTS AFTER FINISH.
- 13) TOLERANCES ARE PER DART QSI 018 UNLESS OTHERWISE NOTED

DEO ATTACHED

RELEASED
08.07.23/17

F	DRAWING UPDATED TO CURRENT STANDARDS. SHT 6 ADDED. ALL SECTION AND DETAIL VIEWS TRANSFERRED TO SHT 6. SHT 1 IN PL PART D2649 QTY UPDATED. SHT 6 SECT C-C GRIND INSTRUCTIONS DELETED FROM NOTE 7 (SEE NCR 239).	AJS	08.08.08
E	REMOVE CBORE, CHG DRILL, ADD CHAMFER	CP	06.03.30
D	REDRAW; INCCRP. DE08136/9153/9163 MOD GROUND HANDLING ON D2650-1/-3	CP	04.05.17
C	CHANGE HOLE PATTERN AND FRONT END	DS	97.10.29
B	AS MANUFACTURED CHANGES	DS	97.06.26
A	NEW ISSUE	DS	97.03.25
REV.	DESCRIPTION	BY	DATE
DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 1 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐																															
Date : _____		Sequence #: _____		QTY Affected : _____		MRB (QSI042)																													
Description Work Order Deviation				Disposition																															
				Completed By																															
				Lead hand / Supervisor																															
				QC / QA Coordinator																															
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY <table border="0"><tr><td>☐ Pressure/Forced</td><td>☐ Contamination</td><td>☐ Power Loss/Surge</td><td>☐ Positioned Wrong</td></tr><tr><td>☐ Bending</td><td>☐ Misaligned/off center</td><td>☐ Folio/Program</td><td>☐ Outside Tolerance</td></tr><tr><td>☐ Crushing</td><td>☐ BOM/Route</td><td>☐ Grain Direction</td><td>☐ Drawing</td></tr><tr><td>☐ Cracks</td><td>☐ Broken/Damage/Defect</td><td>☐ Weld</td><td>☐ Finish</td></tr><tr><td>☐ Crimp/Kink/Ripple/Wave/Twist</td><td>☐ Incomplete/Unclear Instructions</td><td>☐ Wrong Stock Pulled</td><td>☐ Part Lost/Missing</td></tr><tr><td>☐ Marks/Chatter</td><td>☐ Drill Holes</td><td>☐ Out of Sequence</td><td>☐ Misread</td></tr><tr><td>☐ Mislabeled</td><td>☐ Fit/Function</td><td>☐ Off-set/Set-up</td><td></td></tr></table>						☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong	☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance	☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing	☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish	☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing	☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread	☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up	
☐ Pressure/Forced	☐ Contamination	☐ Power Loss/Surge	☐ Positioned Wrong																																
☐ Bending	☐ Misaligned/off center	☐ Folio/Program	☐ Outside Tolerance																																
☐ Crushing	☐ BOM/Route	☐ Grain Direction	☐ Drawing																																
☐ Cracks	☐ Broken/Damage/Defect	☐ Weld	☐ Finish																																
☐ Crimp/Kink/Ripple/Wave/Twist	☐ Incomplete/Unclear Instructions	☐ Wrong Stock Pulled	☐ Part Lost/Missing																																
☐ Marks/Chatter	☐ Drill Holes	☐ Out of Sequence	☐ Misread																																
☐ Mislabeled	☐ Fit/Function	☐ Off-set/Set-up																																	
		Other/Details:																																	

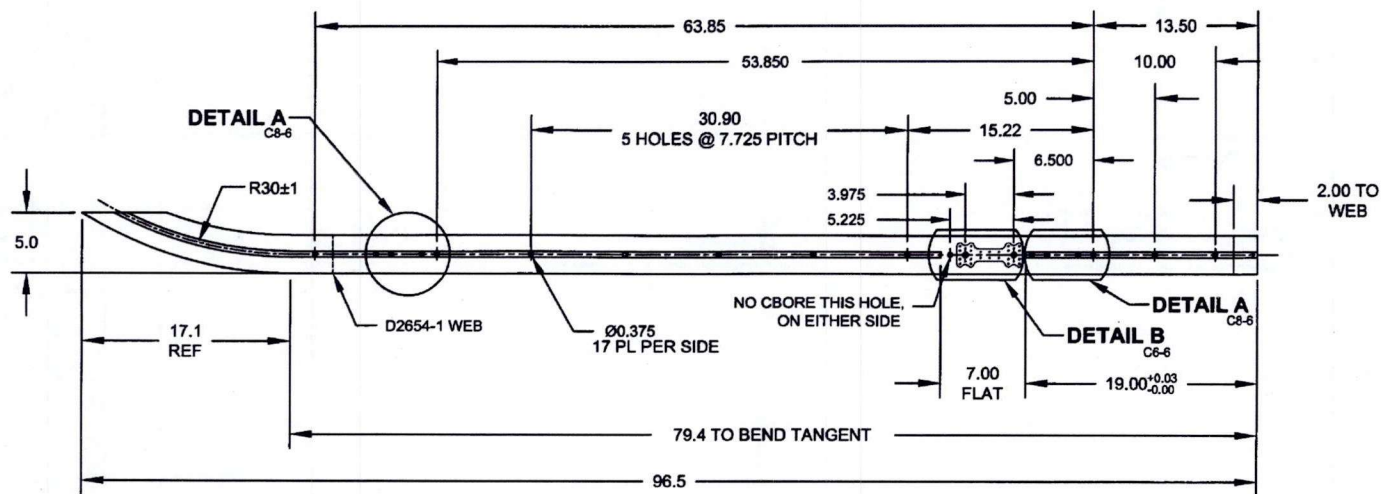

D2650-1 BENDING/DRILLING DETAIL

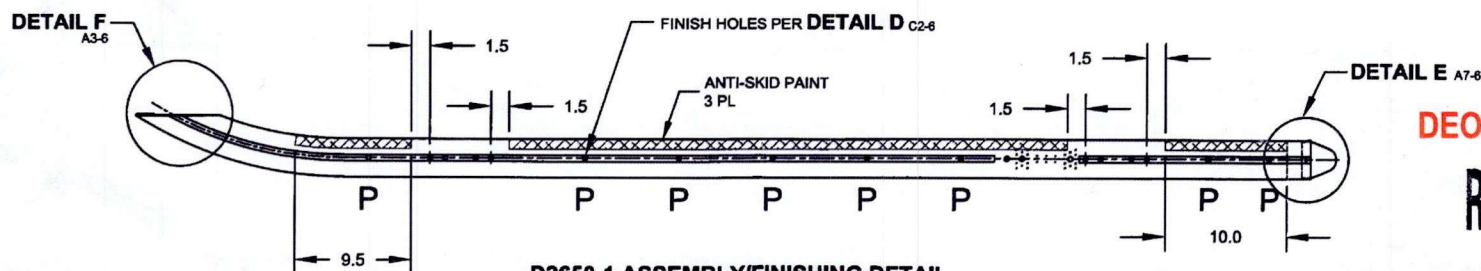

D2650-1 ASSEMBLY/FINISHING DETAIL

DEO ATTACHED
RELEASED
880922/111

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 2 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1987 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

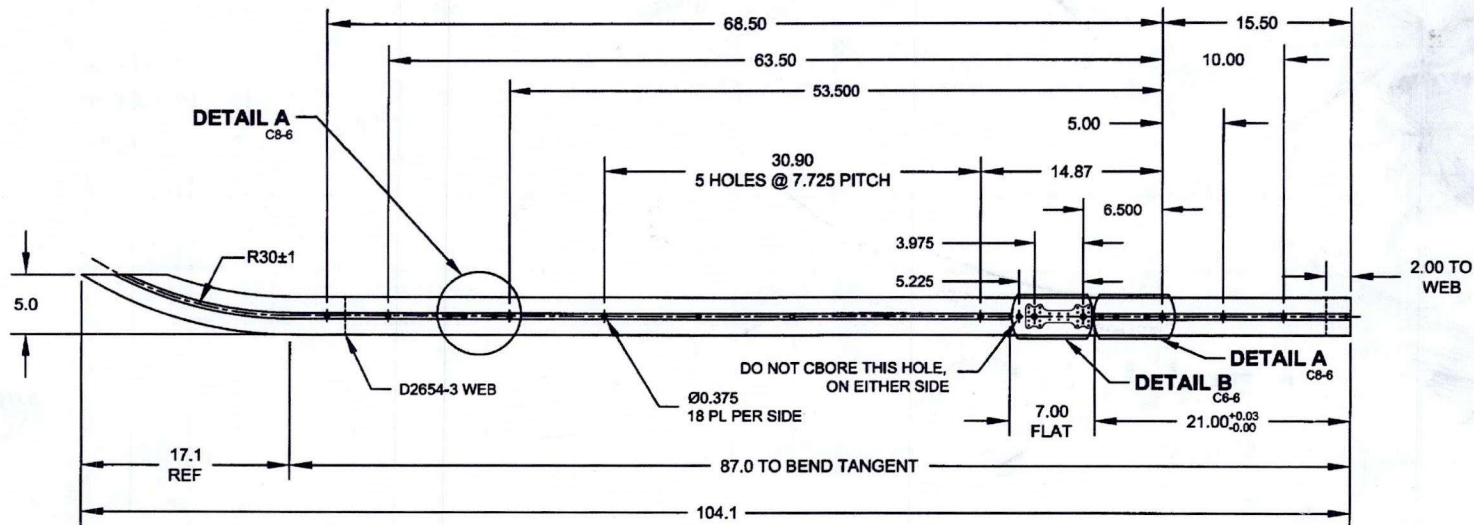

D2650-3 BENDING/DRILLING DETAIL

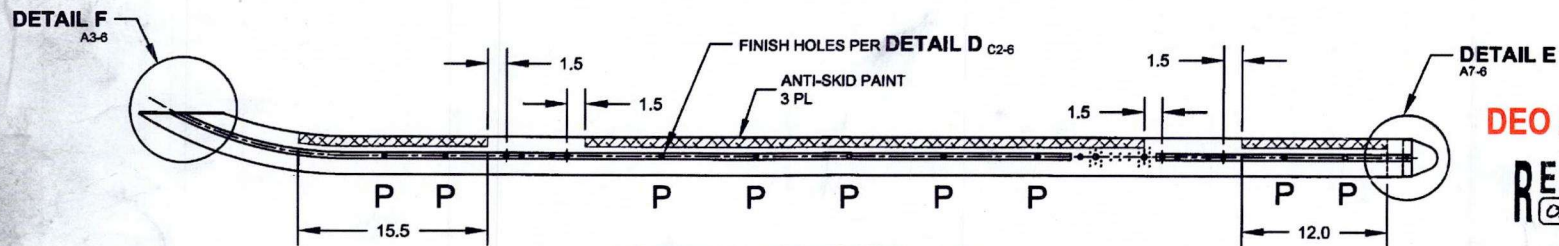

D2650-3 ASSEMBLY/FINISHING DETAIL

**DEO ATTACHED
RELEASED**
05 07 22 111

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 3 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1987 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE


NCR No. _____

Route update only ☐

Job: _____ Part No. _____		DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐		DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :		Sequence #:		QTY Affected :		MRB (QSI042)	
Description Work Order Deviation				Disposition			
				Completed By			
				Lead hand / Supervisor			
				QC / QA Coordinator			
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Preservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread					
		Other/Details:					

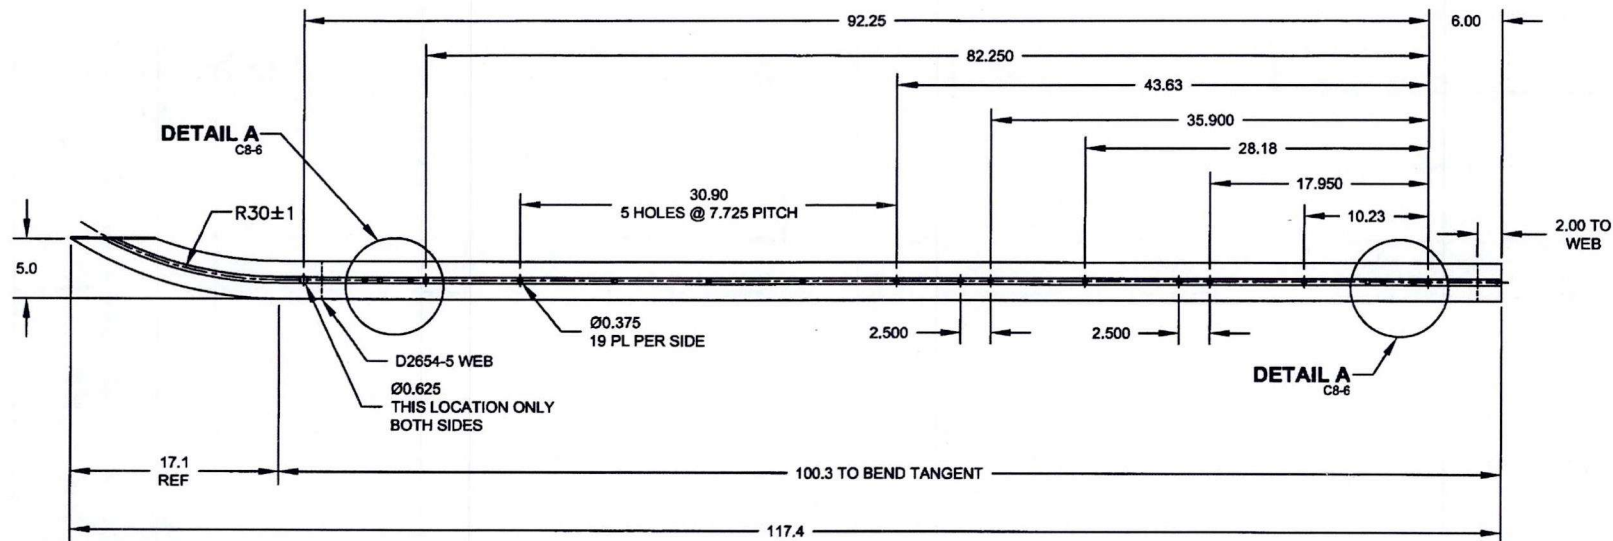

D2650-5 BENDING/DRILLING DETAIL

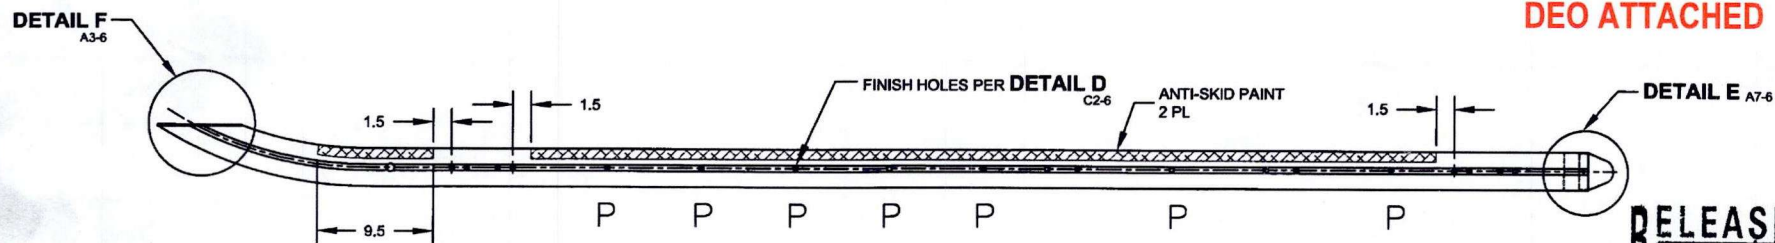

D2650-5 ASSEMBLY/FINISHING DETAIL

DEO ATTACHED

RELEASED
08-09-22/11P

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 4 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.	

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

Entered: _____ Date: _____




WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____


Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	Skid-tube ☐ Machining ☐ Large Fab ☐	DEPARTMENT/PROCESS Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐		
Date :	Sequence #:	QTY Affected :			MRB (QSI042)
Description Work Order Deviation		Disposition			Completed By
					Lead hand / Supervisor
					QC / QA Coordinator
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

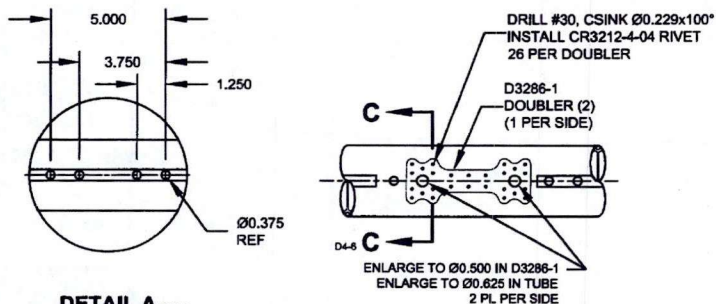


DETAIL A
SCALE 2X

C2-2
D7-2
C2-3
D7-3
C2-4
D7-4
C2-5
D6-5

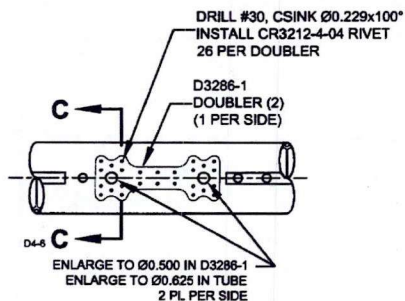


DETAIL B
SCALE 2X

C3-2
C3-3

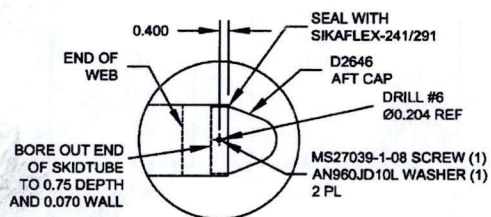

DETAIL E
SCALE 2X


B2-2
B2-3
B1-4
B1-5

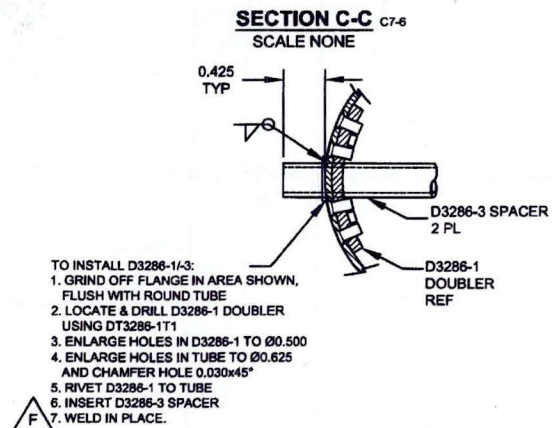

- TO INSTALL D3286-1/3:
1. GRIND OFF FLANGE IN AREA SHOWN, FLUSH WITH ROUND TUBE
 2. LOCATE & DRILL D3286-1 DOUBLER USING DT3286-1T1
 3. ENLARGE HOLES IN D3286-1 TO Ø0.500
 4. ENLARGE HOLES IN TUBE TO Ø0.625 AND CHAMFER HOLE 0.030x45°
 5. RIVET D3286-1 TO TUBE
 6. INSERT D3286-3 SPACER
 7. WELD IN PLACE.




ORIENTATION OF
D2680-041

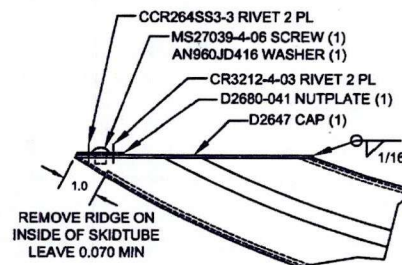

DETAIL F
SCALE NONE

B8-2
B8-3
B8-4
B8-5

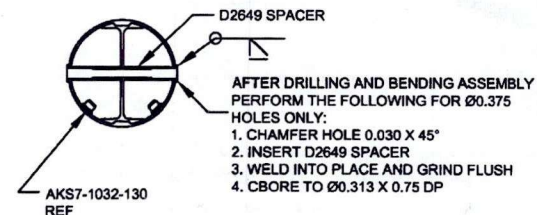

DETAIL D
FOR Ø0.375 HOLES ONLY
SCALE 3X

B4-2
B4-3
B4-4
B4-5

DETAIL F NOTES:

1. CUT TUBE LEVEL
2. REMOVE RIDGE ON FWD SIDE
3. LOCATE D2647 (TRIM AS NECESSARY)
4. WELD D2647 IN PLACE PER DART QSI 004
5. GRIND FLUSH
6. RIVET D2680-041 NUT PLATE IN PLACE

NOTE: MASK THREADS IN D2680-041 PRIOR TO FINISH

RELEASED

DEO ATTACHED

DESIGN	DS	DART AEROSPACE USA, INC	
DRAWN	AJS	PORT HADLOCK, WA	
CHECKED		DRAWING NO.	REV. F
MFG. APPR.		D2650	SHEET 6 OF 6
APPROVED		TITLE	SCALE
DE APPR.		206/407 SKIDTUBE ASSEMBLIES	NTS
DATE	08.08.08	COPYRIGHT © 1997 BY DART AEROSPACE USA, INC	
THIS DOCUMENT IS PRIVATE AND CONFIDENTIAL AND IS SUPPLIED ON THE EXPRESS CONDITION THAT IT IS NOT TO BE USED FOR ANY PURPOSE OR COPIED OR COMMUNICATED TO ANY OTHER PERSON WITHOUT WRITTEN PERMISSION FROM DART AEROSPACE USA, INC.			

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date :	Sequence #:	QTY Affected :		MRB (QSI042)	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐ ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled		FAULT CATEGORY ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details:					

DRAWING NO. D2650	TITLE 206/407 SKIDTUBE ASSEMBLIES	REV. F	DART AEROSPACE LTD ENGINEERING ORDER		D.E.O. NO. D2650-F-1	SHEET NO. SHEET 1 OF 1	SCALE NTS
DRAWN <i>[Signature]</i>	CHECKED A.P.	MFG. APPR. <i>[Signature]</i>	APPROVED <i>[Signature]</i>		DE APPR. <i>[Signature]</i>		
DATE 12.10.12	DATE 12.10.22	DATE 12.10.22	DATE 12.10.22		DATE 12.10.22		

PURPOSE:

CHANGE C'BORED WELDED CROSSBOLT SPACERS TO SWAGED SPACERS

CHANGE:

PARTS LIST IS AMENDED AS FOLLOWS:

IS:


QTY -1	QTY -3	QTY -5	QTY -7	PART NUMBER	DESCRIPTION
1	1	0	0	D2649	CROSS BOLT SPACER
16	17	19	23	D4720-1	SPACER

WAS:

17	18	19	23	D2649	CROSS BOLT SPACER
----	----	----	----	-------	-------------------

ADD DETAIL G BELOW, WHICH IS THE SAME SECTION VIEW AS DETAIL D OF DWG.


C'BORED HOLES ARE **NOW SWAGED** PER DETAIL G BELOW. FOR THE Ø0.375 HOLE THAT IS NOT C'BORED, WELD PER DETAIL D OF DWG (SEE AMENDED DETAIL B FOR REFERENCE).

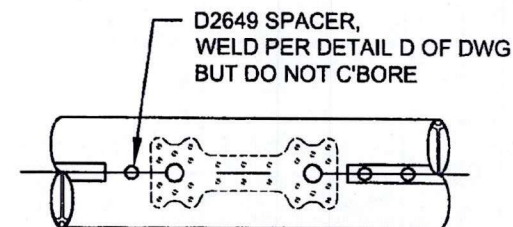

DETAIL B

AMENDMENT TO DETAIL B
NOT TO SCALE

RELEASED
2012-11-16
[Signature]

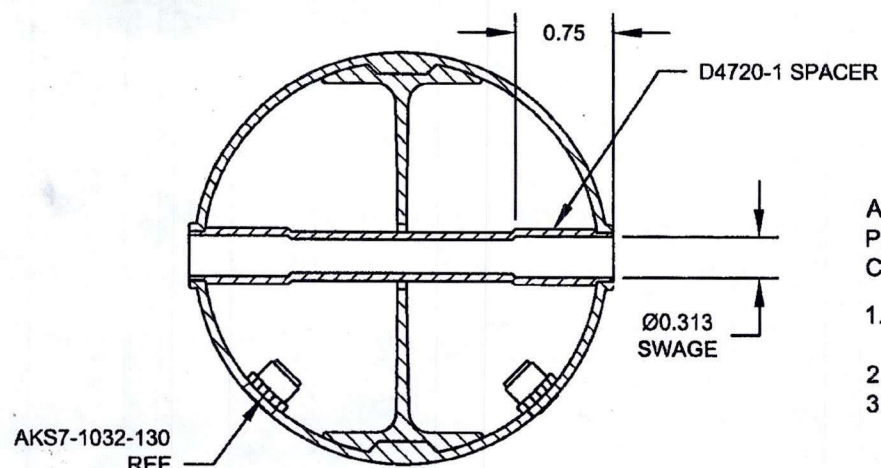

DETAIL G

FOR Ø0.375 HOLES ONLY
FOR HOLES THAT ARE CURRENTLY C'BORED ONLY
NOT TO SCALE

AFTER DRILLING AND BENDING ASSEMBLY
PERFORM THE FOLLOWING FOR Ø0.375 HOLES THAT ARE
CURRENTLY C'BORED:

1. INSERT D4720-1 SPACER, 16 PL (-1) OR 17 PL (-3)
OR 19 PL (-5) OR 23 PL (-7)
2. SWAGE TO Ø0.313 X 0.75 DP PER QSI 002
3. TRIM / GRIND FLUSH PER QSI 002

Entered: _____ Date: _____



WORK ORDER NON-CONFORMANCE / ROUTE UPDATE

NCR No. _____

Route update only ☐

Job: _____ Part No. _____	DISPOSITION Rework ☐ Scrap ☐ Use-as-is ☐	DEPARTMENT/PROCESS Skid-tube ☐ Machining ☐ Large Fab ☐ Cross tube ☐ Small Fab ☐ Finishing ☐ Eng. (Non-AW) ☐ Prod. Eng. Coord. ☐ Rec/Store/Packaging ☐ Engineering ☐ Water Jet ☐ Supplier ☐ Quality ☐			
Date : _____	Sequence #: _____	QTY Affected : _____		MRB (QSI042) _____	
Description Work Order Deviation		Disposition		Completed By	
				Lead hand / Supervisor	
				QC / QA Coordinator	
Root Cause Operator ☐ Manufacturing Process ☐ Equip/Tooling ☐ Handling/Presservation ☐ Material ☐ Product Improvement ☐ Process Improvement ☐ Human Factors ☐		FAULT CATEGORY ☐ Pressure/Forced ☐ Bending ☐ Crushing ☐ Cracks ☐ Crimp/Kink/Ripple/Wave/Twist ☐ Marks/Chatter ☐ Mislabeled ☐ Contamination ☐ Misaligned/off center ☐ BOM/Route ☐ Broken/Damage/Defect ☐ Incomplete/Unclear Instructions ☐ Drill Holes ☐ Fit/Function ☐ Power Loss/Surge ☐ Folio/Program ☐ Grain Direction ☐ Weld ☐ Wrong Stock Pulled ☐ Out of Sequence ☐ Off-set/Set-up ☐ Positioned Wrong ☐ Outside Tolerance ☐ Drawing ☐ Finish ☐ Part Lost/Missing ☐ Misread			
Other/Details: _____					